Quick Start Guide

Mounting the Dispenser:

1. Position the SimpleSink on a vertical wall and make sure that it is within arms reach from an operator, and within 6ft of a water source.
2. Mark the position of the mounting holes on the wall.
3. Drill two ¼" diameter holes at the points marked on the wall.
4. Put the anchors supplied into these holes and screw in the screws without completely tightening
5. Mount the unit and secure tightly.

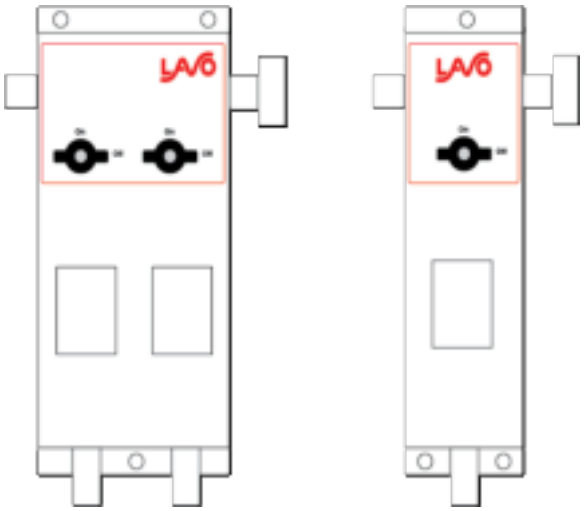

1

Plumbing the dispenser:

1. Insert the water inlet screen into the 3/4" GHT water inlet swivel.
2. Connect the water supply line to the female swivel on the top right of the SimpleSink. Make sure the connection is securely fastened.
3. Once you have decided on a metering tip, insert it into the barb fitting.
4. Install the pick up hose (1/4" ID – 3/8" OD) on to the venturi.
5. Install the discharge tube over the outlet of the venturi.
6. Position the delivery hose above the sink.
7. Install the weight onto the end of the pick up tube, install the foot valve and slide the weight until flush with the foot valve.
8. Place the pick up tube into the product container.

Picture of the Plumbing

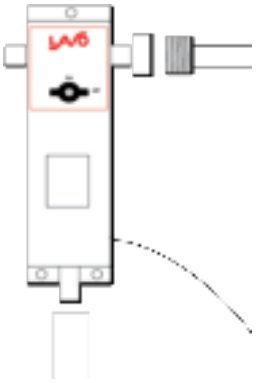

2

Dilutions may vary. Testing completed at 40PSI with water thin products. Use this chart as a starting point for your specific chemical

FLEX GAP

		4 GPM	
	Tip Color	Oz / Gal	Ratio
Standard Metering Tip	No Tip	22	6:1
	Grey	21	6:1
	Black	20	6:1
	Beige	14	9:1
	Red	9	12:1
	White	6	20:1
	Blue	5	24:1
	Tan	4	32:1
	Green	2	64:1
	Orange	1.8	70:1
	Brown	1.5	80:1
	Yellow	1.3	96:1
	Aqua	1.0	128:1
	Purple	0.5	256:1
	Pink	0.4	320:1
	Clear	No Hole	

Ultralean Tip	Lime	0.25	512:1
	Burgundy	0.20	625:1
	Pumpkin	0.15	833:1
	Copper	0.10	1250:1

AIR GAP

		4 GPM	
	Tip Color	Oz / Gal	Ratio
Standard Metering Tip	No Tip	16	6:1
	Grey	16	8:1
	Black	13	10:1
	Beige	11	12:1
	Red	9	15:1
	White	6.2	20:1
	Blue	6	22:1
	Tan	5	25:1
	Green	3.2	36:1
	Orange	2.4	50:1
	Brown	2	64:1
	Yellow	1.8	70:1
	Aqua	1.5	83:1
	Purple	1.0	128:1
	Pink	0.5	256:1
	Clear	No Hole	

Ultralean Tip	Lime	0.25	512:1
	Burgundy	0.17	769:1
	Pumpkin	0.13	1000:1
	Copper	0.09	1429:1